


MOSFET - V3

WITH WIRING

UP TO
4S / 14.8V
LIPOL

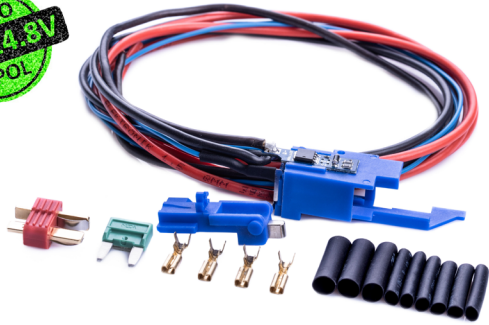

Limitation: spring M160 (current 25A)

This device has to install expert.
He must know how to disassemble airsoft gun and solder.
Never use soldering gun!

www.jefftron.net



How connect device into the gun

- 1) Red wire lead to the battery positive and to the motor positive. Add fuse on this wire close to the battery (included in the package).
- 2) Long black wire lead to the battery negative (mark **-B** on board).
- 3) Short black wire lead to the motor negative (mark **-M** on board).
- 4) Blue wire lead anywhere on the red wire.

When you insert contacts into the gearbox, be careful the wires wont break the mosfet board. Be extra sure to connect the red and black wires appropriately, otherwise you should destroy the device, weapon or battery. Also check right function trigger and cut-off lever with plunger.

